



## Preliminary Information

### PIT5605A Rattle Noise from 60 /40 Rear Seat

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Colorado	2015 - 2019	All	All	All	All
GMC	Canyon	2015 - 2019	All	All	All	All

Involved Region or Country:	North America
Additional RPO/s:	AJ2
Condition:	Rattle noise from the rear 60/40 seat
Cause:	Misalignment of the seat back latch

#### Correction:

Inspect and adjust the rear seat using the information below.

#### Service Procedure:

Inspect the alignment of the bumpers in the latch in relation to the striker. (Illustration 1 below.)

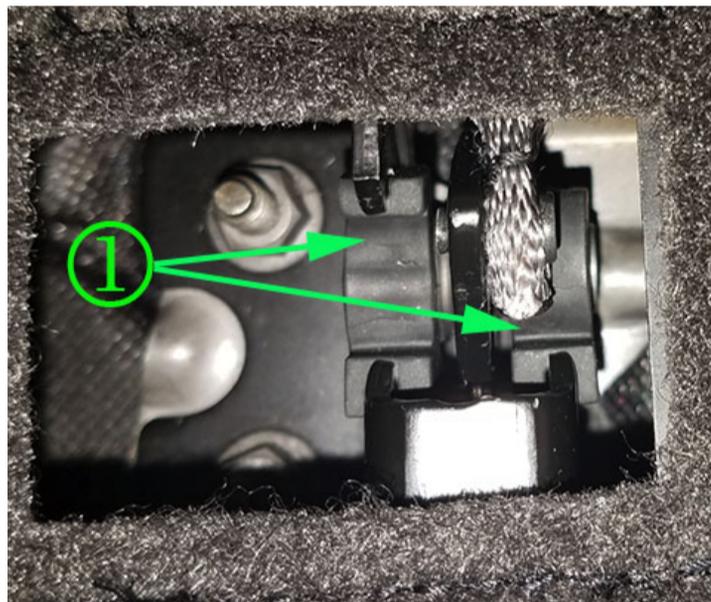


Illustration #2 below shows both bumpers engaged .



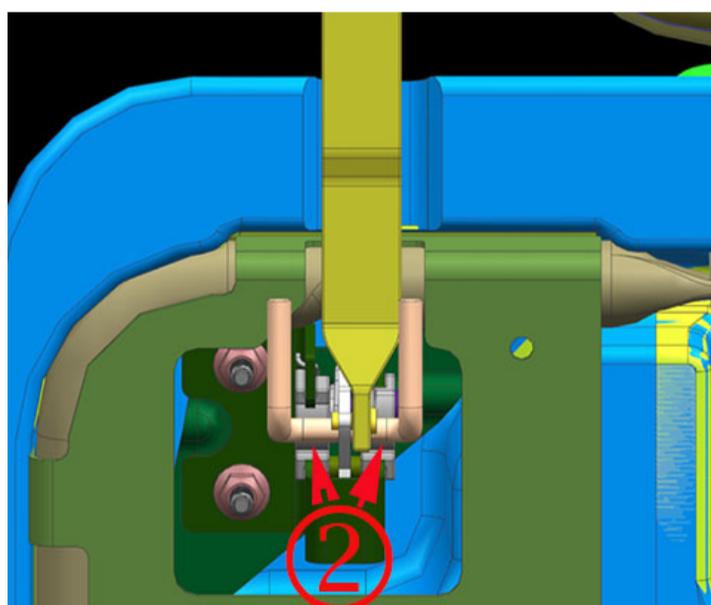


Illustration #3 shows the latch aligned too far right , only one bumper engaged.



**Illustration #4 shows latch aligned too far left , only one bumper engaged.**

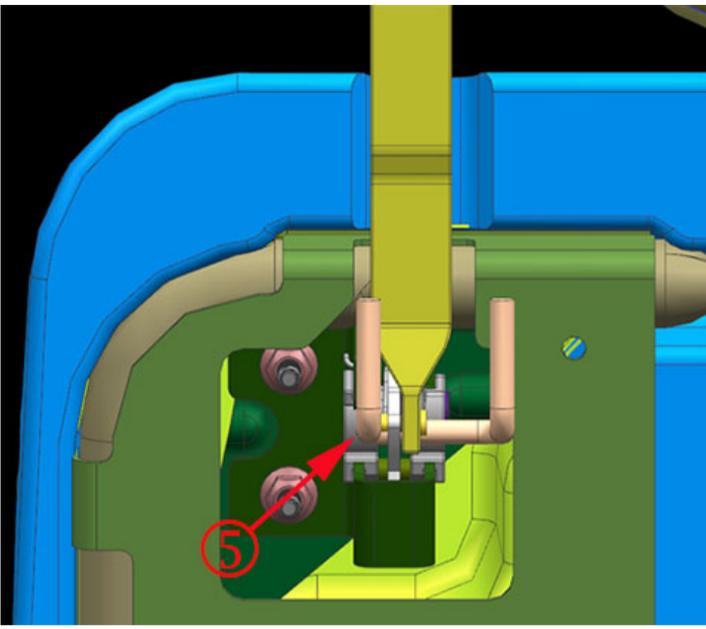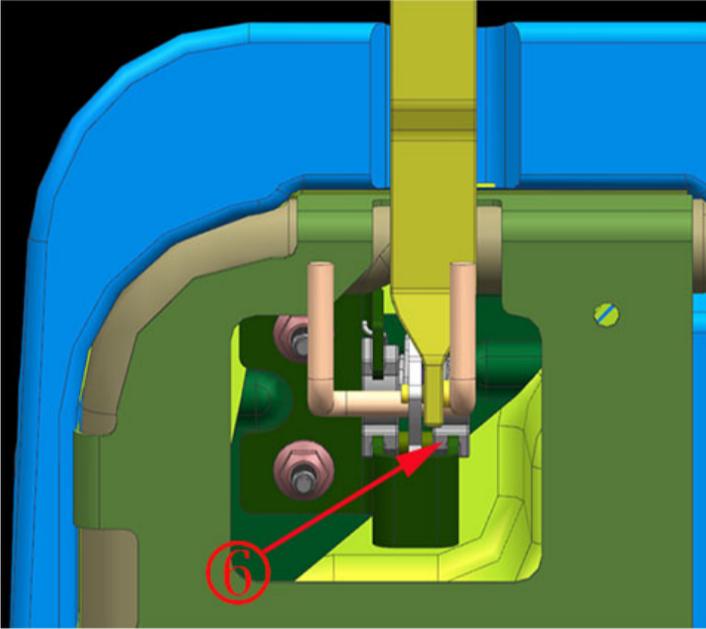

**To align the striker to the insulators , loosen the nuts on the studs left and right shown below and move the seat left or right until centered.**





Once aligned retorque the nuts on the studs to 45 Nm (33 lbs ft) and verify repair.

Warranty Information

Labor Operation:	Description:	Labor Time:
<b>7080538</b>	<b>Adjust Rear Seat Latches</b>	<b>.3 hrs.</b>

Version History

Version	<b>2</b>
Modified	12/18/2017 - Created on 10/17/2018- Updated to Add 18 and 19 model years.



GENERAL MOTORS

© 2018 General Motors. All Rights Reserved.